

SciCan HYDRIM C61WD G4 Quick Reference Guide

Operator's Manual should be consulted before using this washer disinfecter.

BASIC OPERATION



+49 (0) 7561 98 343 - 0

1

Power on the unit.



The button is inside the kick plate.


2

Load Instruments and close the door.



3

Select cycle

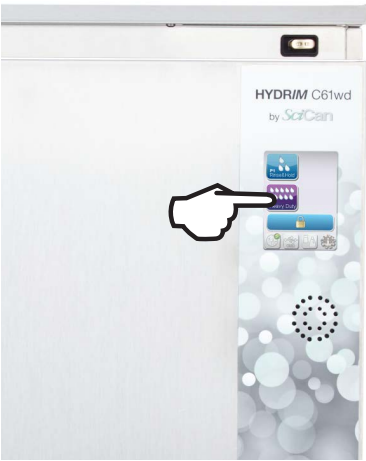

4

Press START.



TOUCHSCREEN



Rinse and Hold Cycle
Prevents soil from drying on instruments.
Incomplete loads that will not be washed within the hour.
NOT a cleaning and disinfection cycle.



Heavy Duty Cycle with Disinfection
Heavily soiled instruments and cassettes.



Door Lock



User/Technician Menu



Network Connection



USB



Water Softener/
Detergent
Level/Door
Status




Enter



Back

Refilling the Water Softener Salt Reservoir

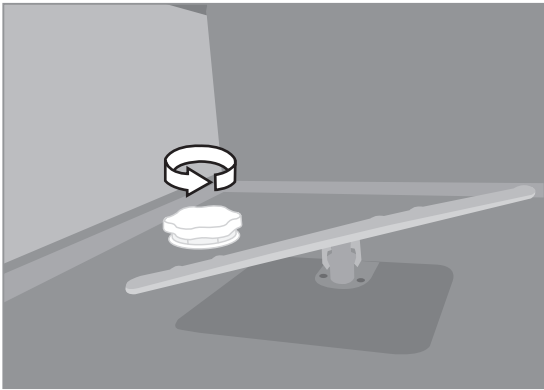

- Unscrew lid.
- Fill to the top (max. 0.5 kg / 1.1 lbs.)
- Screw lid on tightly.
- Run a complete cycle, with no instruments.

IMPORTANT!
If the salt container is being filled for the first time, it **MUST** be filled with at least 1 litre of water before adding the salt.
Only tablet salt should be used in the softening unit. Fine grained salt such as table salt should **NOT** be used as it could clog the unit.
If salt was spilled while refilling, run a cleaning cycle. The water softener salt is also available from SciCan.
Please contact your local dealer.

Cleaning the Chamber


Pour 0.5L of vinegar or citric acid-based instrument neutralizer into the chamber and follow these steps:



IMPORTANT! Do a Chamber Cleaning cycle every 25 cycles. Failure to clean the chamber can promote corrosion.

Replacing the HIP Cleaning Solution

Check your Operator's Manual for more details.

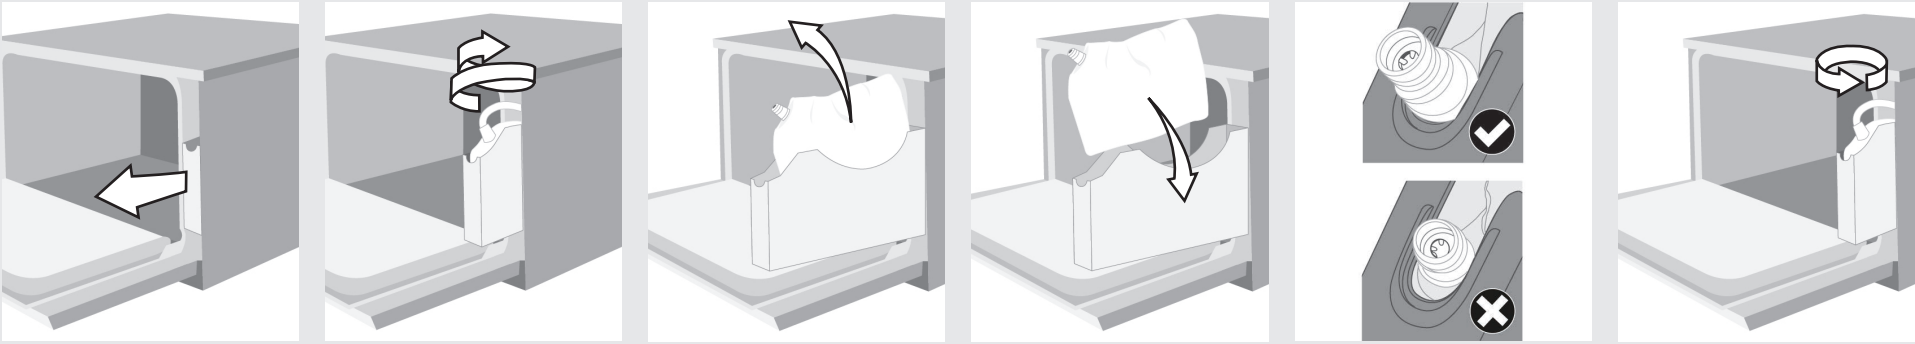

- Recommended precautionary measures with regard to safe handling of HIP solution:**
- Wear undamaged surgical gloves and eye protection.
 - After handling the product, remove and dispose of the gloves and wash hands prior to removing eye protection.

TROUBLESHOOTING

Refer to Operator's Manual for a more comprehensive list. Call for service if suggested recommendations do not resolve the error message.

CF2 Chamber filling failure	Check that the water hoses are not kinked.
	Check that water shut-off valves are opened.
	Call for Service.
CF23 Top wash arm low RPM Top wash arm speed too low.	Check for obstructions to rotation of top wash arm.
	Check that holes in wash arms are not plugged.
CF24 Bottom wash arm low RPM Bottom wash arm speed too low.	Check for obstructions to rotation of bottom wash arm.
	Check that holes in wash arms are not plugged.

Spare Parts and Accessories	
CS-HIPC-U	HIP- Ultra Cleaning Solution (8 x 750 mL)
01-112594S	Water Softener Salt
01-108305S	Water Test Kit
01-114390S	HEPA Filter



Terminal sterilisation of instruments **MUST** follow processing in the HYDRIM C61WD G4.

IMPORTANT!

For non-invasive medical devices, SciCan recommends terminal sterilisation after processing in the SciCan HYDRIM C61WD G4 according to local guidelines. For invasive medical devices, such as dental handpieces, terminal sterilisation must be performed after processing in the SciCan HYDRIM C61WD G4.