

3M™ Locator Plate 3443-82-XX Instruction Guide for the assembly of 3M™ Ribbon Cable Sockets, Series 451

General

The assembly of 3M™ Ribbon Cable Sockets, Series 451 .05" x .05" and 3M™ Flat Ribbon Cable .025" can be accomplished when using the durable metal 3M™ Locator Plates, Series 3443-82-XX and the 3M™ Assembly Press, Models 3640 and 3335.

A customer 3D printed 3M™ Locator Plate 3443-81-XX option is available for lower volume applications. See drawing 78-5100-2644-2 and Instructions Guide 78-9102-1086-9.

Connector Part Number	Locator Plate Number	Platen Part Number	3436-1K Shut Height Setting	
			Press 3640/3316	Press 3335
45104	3443-82-04	3442-9	7	7.5
45106	3443-82-06	3442-9	7	7.5
45108	3443-82-08	3442-9	7	7.5
45110	3443-82-10	3442-9	7	7.5
45112	3443-82-12	3442-9	7	7.5
45114	3443-82-14	3442-9	7	7.5
45116	3443-82-16	3442-9	7	7.5
45120	3443-82-20	3442-9	7	7.5
45126	3443-82-26	3442-9	7	7.5
45130	3443-82-30	3442-9	7	7.5
45134	3443-82-34	3442-9	7	7.5
45140	3443-82-40	3442-9	7	7.5
45150	3443-82-50	3442-9	7	7.5

Locator Plate Features

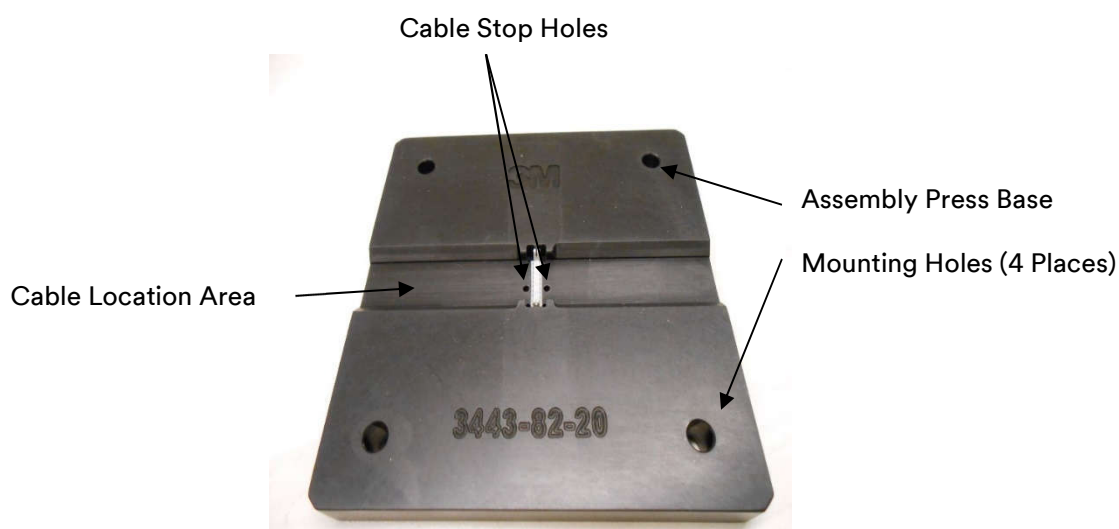


Figure 1: 3M™ Locator Plate 3443-82-20

3M™ Locator Plate 3443-82-XX Instruction Guide for the assembly of 3M™ Ribbon Cable Sockets, Series 451

Procedures for Adjusting the Press Shut Height

The shut height should be adjusted from the base before the locator plate is put into place. The 3M™ Assembly Presses 3316 and 3640 are adjusted with a knob at the top of the press. The 3M™ Assembly Press 3335 is adjusted with the collar on the press shaft and 3M™ Assembly Press 3830 is self-adjusting.

The shut height adjustment is made from the base of the assembly press without the locator plate or platen in place. Lower the handle of the press until the handle casting makes contact with the press casting (See Figure 2)

Place the shut height gauge across the press base.



Figure 2

Rotate the shut height to lower or raise adjustment feature until the bottom of the shaft tightly contacts the desired position on the shut height gauge. (See Figures 3 and 4)



Figure 3



Figure 4

Install the 3M™ Locator Plate and the appropriate platen on the press. The platen should be positioned parallel with the connector body and cover. (See Figure 5)



Figure 5

3M™ Locator Plate 3443-82-XX Instruction Guide for the assembly of 3M™ Ribbon Cable Sockets, Series 451

Procedures for Cable Termination

Before assembly of the connector can take place, the cable end must be cleanly cut with a sharp blade. The end must be at a 90 degree angle to the length of the cable.

Place the cover into the locator plate. (See Figure 6)



Figure 6

Slide the properly sized ribbon cable onto the cover in the locator plate (See Figure 7). 0.0625" diameter dowel pins can be used in the cable-stop location holes if so desired. Cable-stop location holes are not available on sizes 4, 6, 8 and 10.



Figure 7

Place the socket connector onto the cover over the cable, verifying the pin 1 indicator is in the correct position. (See Figure 8)



Figure 8

3M™ Locator Plate 3443-82-XX Instruction Guide for the assembly of 3M™ Ribbon Cable Sockets, Series 451

Bring the handle of the press down until the IDCs press into cable and the connector fully seats into the cover. (See Figure 9)



Figure 9

Visually inspect termination to ensure that:

- Cover is fully seated and parallel to the body. Cover latches are fully engaged.
- Cable is properly aligned with the cover
- Cover retaining devices on the body are flush with the cover ends (See Figure 10)

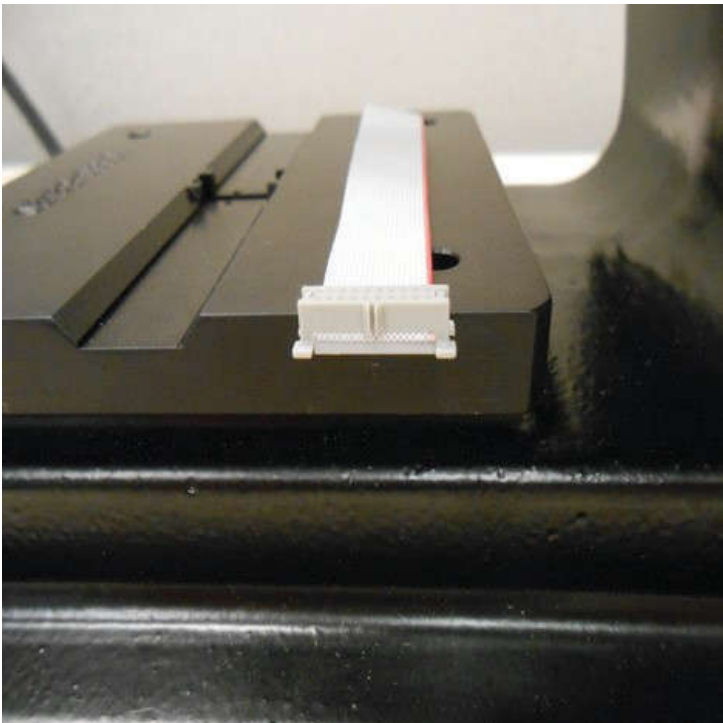


Figure 10

3M™ Locator Plate 3443-82-XX Instruction Guide for the assembly of 3M™ Ribbon Cable Sockets, Series 451

Strain Relief Attachment

Fold the cable back over the cover. (See Figure 11)



Figure 11

Place the strain relief in the connector over the cable, sliding the strain relief into the slots of the connector. (See Figure 12)

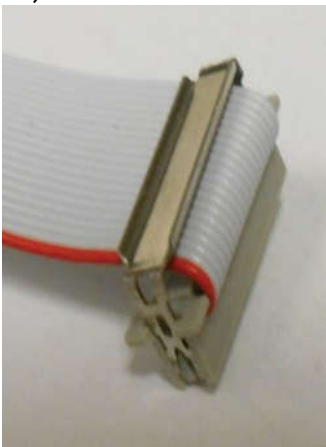


Figure 12

Press the strain relief down until the strain relief snaps into the correct position on the connector. (See Figure 13)

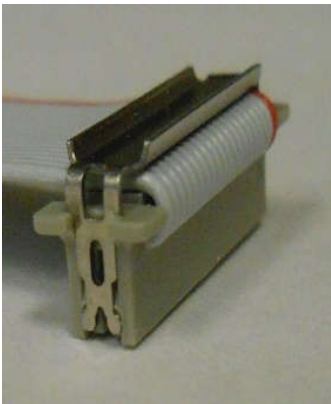


Figure 13

3M™ Locator Plate 3443-82-XX Instruction Guide for the assembly of 3M™ Ribbon Cable Sockets, Series 451

Regulatory: For regulatory information about this product, contact your 3M representative.

Technical Information: The technical information, guidance, and other statements contained in this document or otherwise provided by 3M are based upon records, tests, or experience that 3M believes to be reliable, but the accuracy, completeness, and representative nature of such information is not guaranteed. Such information is intended for people with knowledge and technical skills sufficient to assess and apply their own informed judgment to the information. No license under any 3M or third party intellectual property rights is granted or implied with this information.

Product Use: Many factors beyond 3M's control and uniquely within user's knowledge and control can affect the use and performance of a 3M product in a particular application. As a result, customer is solely responsible for evaluating the product and determining whether it is appropriate and suitable for customer's application, including conducting a workplace hazard assessment and reviewing all applicable regulations and standards (e.g., OSHA, ANSI, etc.). Failure to properly evaluate, select, and use a 3M product in accordance with all applicable instructions and with appropriate safety equipment, or to meet all applicable safety regulations, may result in injury, sickness, death, and/or harm to property.

Warranty, Limited Remedy, and Disclaimer: Unless a different warranty is specifically stated on the applicable 3M product packaging or product literature (in which case such warranty governs), 3M warrants that each 3M product meets the applicable 3M product specification at the time 3M ships the product. **3M MAKES NO OTHER WARRANTIES OR CONDITIONS, EXPRESS OR IMPLIED, INCLUDING, BUT NOT LIMITED TO, ANY IMPLIED WARRANTY OR CONDITION OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, OR ANY IMPLIED WARRANTY OR CONDITION ARISING OUT OF A COURSE OF DEALING, CUSTOM, OR USAGE OF TRADE.** If a 3M product does not conform to this warranty, then the sole and exclusive remedy is, at 3M's option, replacement or repair of the 3M product or refund of the purchase price.

Limitation of Liability: Except for the limited remedy stated above, and except to the extent prohibited by applicable law, 3M will not be liable for any loss or damage arising from or related to the 3M product, whether direct, indirect, special, incidental, or consequential (including, but not limited to, lost profits or business opportunity), regardless of the legal or equitable theory asserted, including, but not limited to, warranty, contract, negligence, or strict liability.

Disclaimer: For industrial use only. Not intended, labeled or packaged for consumer sale or use.



Electronics Materials Solutions Division
3M Center, Building 224-3N-11
St. Paul, MN 55144-1000
1-800-251-8634 phone
651-778-4244 fax
www.3M.com/electronics

3M is a trademark of 3M Company.
Please recycle.
©3M 2022. All rights reserved.
78-9101-8937-8

