



<<<<<< IT IS RECOMMENDED THAT THIS PRODUCT BE INSTALLED BY A QUALIFIED TECHNICIAN >>>>>>

(800)736-2114

HUSQVARNA

2020 Vitpilen/Svartpilen 401

- 1) Remove side exhaust canister (1- bolt, 1- nut, 1- clamp).
- 2) Remove front lower heat shield (5- bolts). *FIG's (A) & (B)
- 3) Remove headpipe (1- O2 sensor, 2- bolts, 1- clamp).
- 4) Remove center exhaust chamber (2- upper bolts, 1- lower bolt).
NOTE: remove u-nuts from frame to prevent loss.
- 5) Transfer grommet, lower spacer tube, and large inlet gasket from center exhaust chamber *FIG (C) to WerkesUSA Chamber Delete *FIG (D).
- 6) Install headpipe (leave loose).
- 7) Install WerkesUSA Chamber Delete using stock bolt and clamp (leave loose). *FIG (E)
- 8) Install side exhaust canister using stock hardware (leave loose).
- 9) Check clearances of headpipe and tighten. Securely install O2 sensor.
- 10) Tighten clamp and bolt on WerkesUSA Chamber Delete.
- 11) Tighten clamp and bolt on side exhaust canister.
- 12) Clean exhaust with WD-40 (or similar) before starting.

"IMPORTANT" To insure uniform coloring thoroughly clean with WD-40 or like product before starting motorcycle **"IMPORTANT"**

PARTS LIST:

1- WerkesUSA Chamber Delete



The purchaser releases Competition Werkes Inc. from all liabilities pertaining to the installation and use of purchased parts. Purchaser recognizes that any alteration and/or modifications to the vehicle may increase the risk of injury or accident, and may also render the vehicle illegal for use on public roads.

WHV402D



<<<<<< IT IS RECOMMENDED THAT THIS PRODUCT BE INSTALLED BY A QUALIFIED TECHNICIAN >>>>>>

(800)736-2114

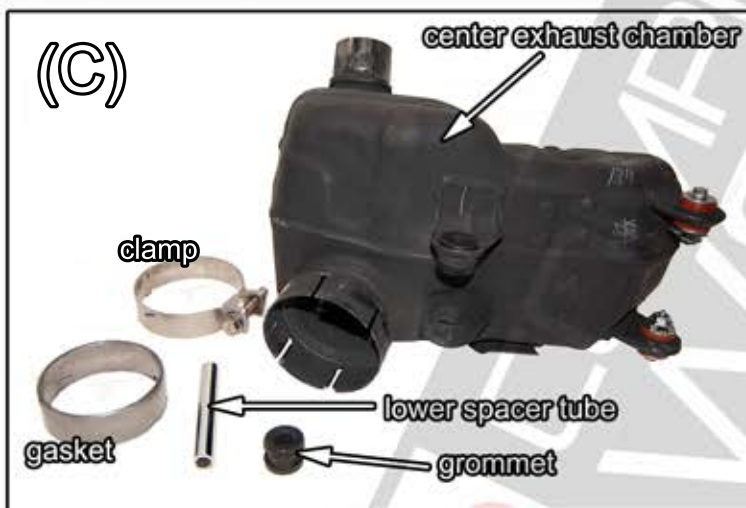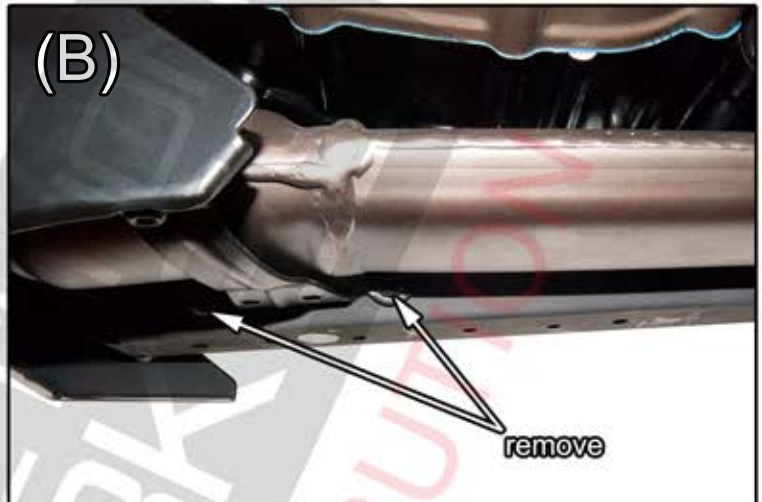

"IMPORTANT" To insure uniform coloring thoroughly clean with WD-40 or like product before starting motorcycle **"IMPORTANT"**

The purchaser releases Competition Werkes Inc. from all liabilities pertaining to the installation and use of purchased parts. Purchaser recognizes that any alteration and/or modifications to the vehicle may increase the risk of injury or accident, and may also render the vehicle illegal for use on public roads.

WHV402D